AngloAmerican

GROSVENOR COAL MINE

TEM-SMRT Meeting Minutes

Meeting Minutes	**LW104 CH 4002**		
Date / Time	02/05/20 14:30		
Location	Tech Serv.		
Chairperson	Neil Bryan		
Attendees	**Name**		**Initial**
Undermanager	Neil Bryan		NB
Mine Geologist	James McGuiness		JM
LW Mining Co-Ordinator	Mick Copeland		MC
Roster Geotech.	Ed Steed		ES
Undermanager	Adam Kruse		BC
VO	Mark Johnston		MJ
Apologies			
-			
File Location	W:\Technical Services\Shared_LW104\11. IMT Minutes\SMRT\		
Minutes Taken / Updated by	James McGuiness		
Objective	Review conditions and determine a plan for going forward		

Ref	Description	Owner	Due date
1.0 Background Information			
	• 3.2m Normal Fault #108, 0.8m Normal Fault #138 • Delamination mostly 0.5-1m and increasing to top of seam in parts through large area, #97-132 • TTF good, mostly 1m and able to knuckle up, up to 1.5m in parts. • Probable low angle, face parallel shear extending from TG in combination with two faults, and proximity to turnaround, creating wide spread delamination • Additional cavity to top of seam 147-149, TG goaf normal, to rear #149 and rill around 3 cans visible into goaf • Pre-consolidation in TG from Ch4001 – 3989 • Slow retreat due to gas and maintenance window last 24hr. LONGWALL 104 FACE PROFILE 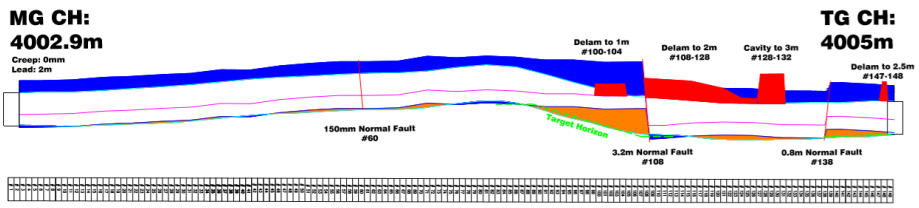 		

Ref	Description	Owner	Due date
	 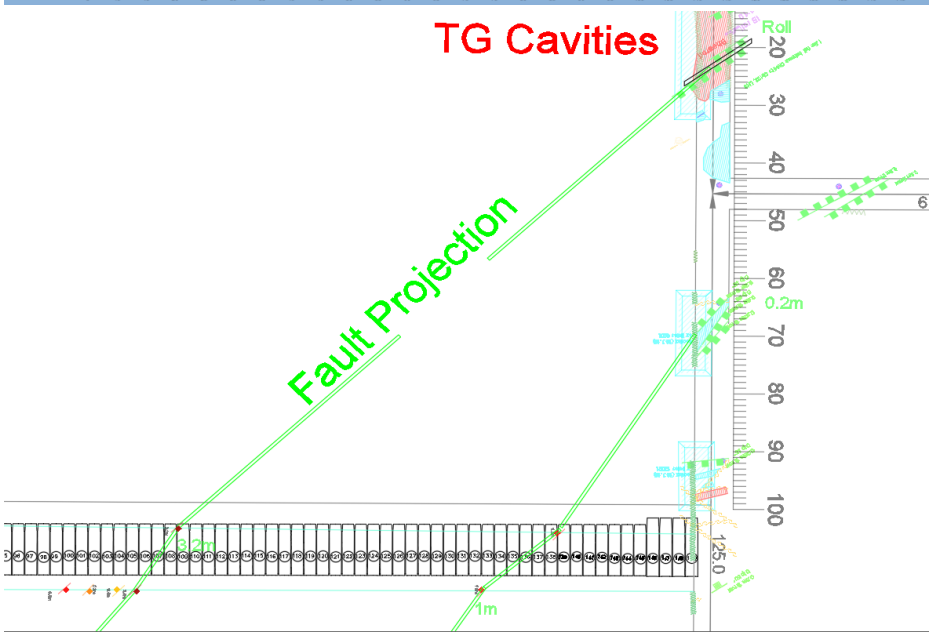 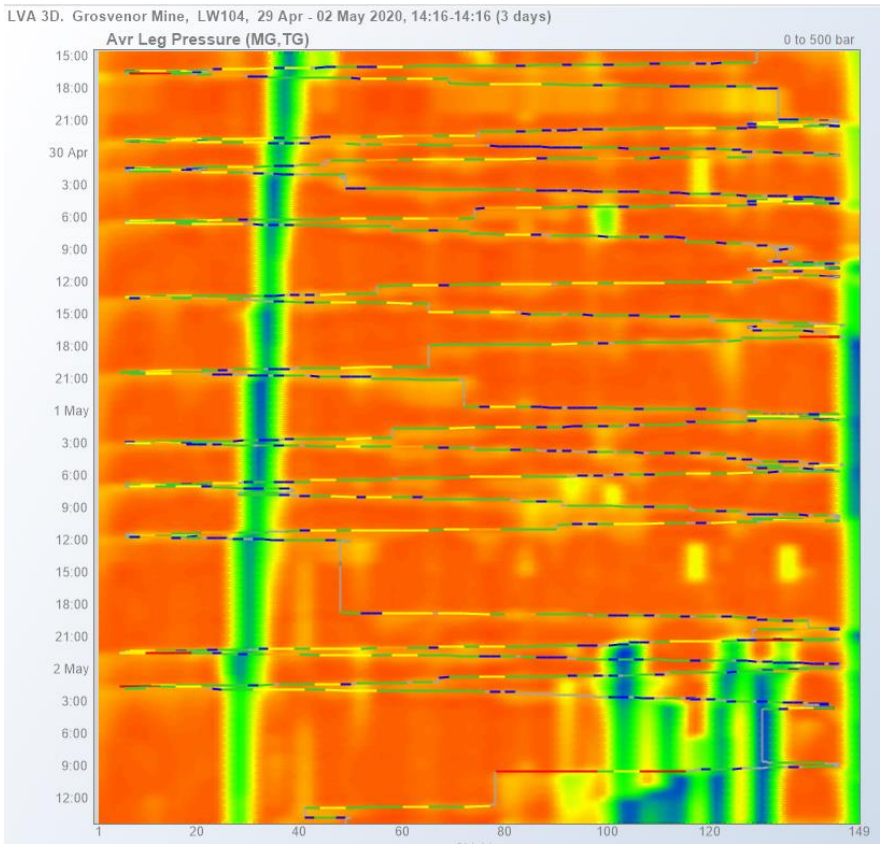		

Ref	Description	Owner	Due date
2.0 Discussion Points			
	• Interaction of structures • Option of extending consolidation to TG • DSI previously mobilised, gear in position		
3.0 Plan Moving Forward			
	• PUR 97 – 132, 4.5m up holes (C) • Fill 112-116 • Review opportunities for TG PCB installation work		
Next Meeting date / Time	**As required**		

Actions from SMRT Meeting		
Action	**Who**	**When**
Circulate Fill Plan	JRM	Now